


Unitap

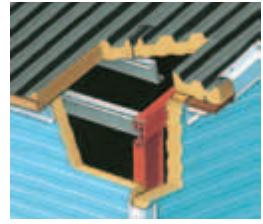

Designation	Dimension	Corrosivity class	Bits/ sockets	Quantity/ box	Area of application
-------------	-----------	-------------------	---------------	---------------	---------------------

Self-tapping screws, C-thread, to light section steel

FC11	6,3 x 19	C2-C3	8 mm	250	Self-tapping screws for pre-drilled holes, intended for fixing in light section steel 1,5-3mm. See installation instructions for choice of drill diameter. Long dimensions are suitable for fixing of sandwich panels to light section steel.
FC12	6,3 x 25	C2-C3	8 mm	250	
FC13	6,3 x 38	C2-C3	8 mm	250	
FC14	6,3 x 51	C2-C3	8 mm	200	
FC15	6,3 x 64	C1-C2	8 mm	150	
FC16	6,3 x 75	C1-C2	8 mm	150	
FC20	6,3 x 100	C1-C2	8 mm	100	
FC22	6,3 x 130	C1-C2	8 mm / 3/8"	100	
FC25	6,3 x 175	C1-C2	8 mm / 3/8"	100	



FC50	4,8 x 16	C4	8 mm	250
FC52	4,8 x 25	C4	8 mm	250
FC53	4,8 x 38	C4	8 mm	250
FC54	4,8 x 51	C4	8 mm	250



FC61	6,3 x 19	C4	8 mm	250	Stainless steel self-tapping screws for pre-drilled holes, intended for fixing in light section steel 1,5-3mm. See installation instructions for choice of drill diameter. Long dimensions are suitable for outdoor fixing of sandwich panels to light section steel.
FC62	6,3 x 25	C4	8 mm	250	
FC63	6,3 x 38	C4	8 mm	250	
FC64	6,3 x 51	C4	8 mm	200	
FC65	6,3 x 64	C4	8 mm	150	
FC66	6,3 x 75	C4	8 mm	150	
FC70	6,3 x 100	C4	8 mm	100	
FC73	6,3 x 130	C4	8 mm / 3/8"	100	
FC74	6,3 x 150	C4	8 mm / 3/8"	100	
FC75	6,3 x 175	C4	8 mm / 3/8"	100	
FC76	6,3 x 200	C4	8 mm / 3/8"	100	
FC77	6,3 x 220	C4	8 mm / 3/8"	100	
FC79	6,3 x 260	C4	8 mm / 3/8"	100	



Self-tapping screw, C-thread, "Repairing screw"

FC91	7,2 x 19	C4	8 mm / 3/8"	100	Stainless steel self-tapping screw for repairing of damaged holes.
------	----------	----	-------------	-----	--



Guideline values, drill diameter self-tapping screws, type C:

Screw Ø	Steel thickness	Drill Ø
4,8	1,0 - 1,5	3,7
4,8	1,6 - 2,0	3,9
6,3	1,25 - 1,5	5,0
6,3	2,0 - 3,0	5,3

Installation instructions:

Use variable or low speed power driver. Recommended speed 300-600 rpm. Hole diameters according to the table, should be seen as guidelines.